

DATE 1620Z 26 FEB 65

SECRET

1	INTEL	9
2	DFA	10
3	CC	11
4	IDEA	12
5	OAD	13
6	DECH	14
7	RB	15
8		16

ROUTINE

IN73964

TO DIRECTOR

FROM

ACTION:

INFO :

TOR: 1710Z 26 FEB 65

OSA 1-15

TO PRIORITY

INFO

CITE

25X1

25X1A

A. C055C

B. FOLLOWING IS QUALITY EVALUATION REPORT OF FIELD PROCESSED MISSION C055C WHICH WAS DONE ON MODEL 3 MACHINE.

1. GENERAL APPEARANCE OF THE ORIGINAL NEGATIVE IS GOOD TO EXCELLENT.

2. REWASHING WAS NOT NECESSARY. TESTS AT  INDICATED ARCHIVAL QUALITY.

25X1A

3. SCISSOR CUT, MADE AT FOLLOWING FRAMES, WANDERED INTO FORMAT AREA FROM 1/8 TO 1/4 INCH.

9R 0256-0257 - TITLE NDRS.

9L 0265-0266 - " "

4. EXAMPLES OF EMULSION SCRATCHES ON FOLLOWING FRAMES WERE PROBABLY CAUSED BY RESTART ON PROC. MACH. TAKE UP SPOOL AFTER MACHINE CUT.

9R - 0257

9L - 0266 & 0267

S E C R E T

25X1A

[REDACTED]

PAGE TWO

5. EXAMPLES OF HANDLING MARKS AT MACHINE CUTS.

9R - 0256

9L - 0265

6. HANDLING TROUBLES MENTIONED IN PARAS 3, 4 AND 5 COULD BE ELIMINATED BY INSTALLATION OF ADDITIONAL EQUIPMENT AT MODEL 3 MACHINE TAKE OFF. AUTHORITY TO PROVIDE WAS REQUESTED BY [REDACTED] FROM

25X1A

25X1A

[REDACTED] ON 17 DECEMBER.

7. 9L, FRAME 0538 SHOWS 3 SPOTS WHICH ARE PINK IN COLOR EACH ABOUT 1/16 INCH IN DIAMETER. CAUSE UNKNOWN.

8. 9L, FRAMES 0163 & 0164 TITLE SMEARED DUE TO ERASURE AND RE-TITLING. NUMEROUS INSTANCES ON BOTH 9L AND 9R OF BLOCKED IN TITLING WITHIN LOOP OF G'S, 9'S AND R'S. TITLING DONE AT [REDACTED]

25X1A

9. 9R, FRAME 0396, MYLAR TAPE REPAIR MADE. FILM TORN 1 INCH FROM CLOCK EDGE WHILE CHANGING IDENT. THIS DAMAGE DONE AT [REDACTED]

25X1A

10. PROCESSING STREAKS ON 9L, MENTIONED IN [REDACTED] FROM

25X1A

25X1A

[REDACTED] NOT NOTICABLE ON 5 PARTS SENT TO [REDACTED]

25X1A

END OF MESSAGE

S E C R E T